Section 3 SOP for SO2 May 2016 Page 1 of 35 Revision 1

FORSYTH COUNTY OFFICE OF ENVIRONMENTAL ASSISTANCE AND PROTECTION



STANDARD OPERATING PROCEDURE (SOP)

Sulfur Dioxide (SO2)

Section 3 SOP for SO2 May 2016 Page 2 of 35 Revision 1

Signature Page

By the signatures below, the Forsyth County Office of Environmental Assistance and Protection (FCEAP) certifies that the information contained in the following Standard Operating Procedure (SOP) is complete and fully implemented as the official guidance for our Office. However, due to circumstances that may arise during the sampling year, some practices may change. If a change occurs, a notification of change and a request for approval will be submitted to EPA Region 4 at that time.

Name: <u>Cary Gentry</u> Title: <u>FCEAP QA Specialis</u>	_Signature: t	Can O. CG	Date: <u>5/17/16</u>
Name: <u>Jason Bodenhamer</u> Title: <u>FCEAP Program Mana</u>	_Signature:	Joson Bocleshon	Date: <u>5/17/16</u>
Name: <u>Minor Barnette</u> Title: <u>FCEAP Director</u>	_Signature:	Minoi Barnetto	Date: <u>5/17/16</u>
Name: Title:	_Signature:_		_Date:
Name: Title:	_Signature:_		_Date:

Table of Contents

3.0 Introduction	. 4
3.1 Procurement of Calibration Standards, Zero Gases, and Monitoring Instrumentation	. 4
3.1.1 General Information	. 4
3.1.2 Specifications for Calibration Standards, Zero Gases and Monitoring Instrumentation	. 5
3.1.3 Gas Standard and Initial Instrument Checks	. 6
3.2 Initial Monitor Setup	. 8
3.2.1 Site Requirements	. 8
3.2.2 Monitor Installation - Thermo Model 43i-tle SO2 Analyzer	. 9
3.2.3 Analyzer Datalogger setup with iPort software	12
3.2.4 Initial Analyzer Checks and Adjustment	12
3.3 Thermo Environmental Model 43i-tle SO2 Analyzer Instrument Description	13
3.4 Calibrations/Verifications of a Thermo 43i-tle SO2 Analyzer	13
3.4.1 Adjusted Multi-Point Calibration	13
3.4.2 Ozone 90-day Verification	20
3.5 Teledyne API 701 Zero Air Generator, Teledyne API T701H Zero Air Generator	23
3.6 Thermo Environmental Model 43i-tle Maintenance	24
3.6.1 Inspection of Pressure Reducing Capillary	24
3.6.2 Fan filter inspection and cleaning	24
3.6.3 Particulate Filter Inspection	25
3.6.4 Flow check	25
3.7 Routine site visits	26
3.7.1 Visit Requirements	26
3.8 Quality Assurance/Quality Control checks	26
3.8.1 Performance Audit procedure	27
3.8.2 Bi-weekly Zero/Span/Precision (ZSP) Checks	30
3.9 Data Handling - Documentation, Analysis, Editing, and Reporting	34
REFERENCES	35

Section 3 SOP for SO2 May 2016 Page 4 of 35 Revision 1

REVISION	DATE	CHANGES TO SOP	

STANDARD OPERATING PROCEDURES FOR SULFUR DIOXIDE (SO₂) Forsyth County Office of Environmental Assistance and Protection

3.0 Introduction

All equipment, chemicals, field operating procedures, and laboratory operating procedures for the continuous measurement of sulfur dioxide in the atmosphere using the pulsed fluorescence method are selected and performed according to (equivalent method) EQOA-0486-060 requirements. The following procedure manual is to be used as a supplement to the Code of Federal Regulations (CFR). Siting and various quality assurance (QA) procedures are followed in accordance with the Code of Federal Regulation Title 40 Part 50, Part 58 and EPA-454/B-13-003: Quality Assurance Handbook for Air Pollution Measurement Systems: Volume II Ambient Air Quality Monitoring Program.

This "Standard Operating Procedure" (SOP) will provide guidance for the monitoring of SO₂ using the ESC 8832 datalogger, Thermo Environmental Instruments, Inc. 43i-tle Analyzer (Equivalent Method Number: EQOA-0486-060), Teledyne API 700EU Dynamic Dilution Calibrator and a Teledyne API T701H Zero Air Generator

3.1 Procurement of Calibration Standards, Zero Gases, and Monitoring Instrumentation

3.1.1 General Information

3.1.1.1 Calibration standards include known concentrations of sulfur dioxide used for calibrations, audits, precision checks, and span checks.

3.1.1.2 All calibration, audit, precision, and gas standards must be traceable to National Institute of Standards and Technology (NIST) Standard Reference Materials (SRM) or NIST/EPA

Section 3 SOP for SO2 May 2016 Page 5 of 35 Revision 1

approved commercially available certified Reference Materials (CRM); using EPA approved traceability Protocols. A "Certificate of Analysis" must accompany each gas certified to EPA Protocols. A copy of these certificates should be kept in the office by the QA staff member who oversees gas cylinder renewals. The API 700EU calibrator's Mass Flow Controllers (MFCs) must have their flow certified every 6 months and when necessary, calibrated to match a NIST traceable flow device. The flow certification process is covered in the Calibrator Operation SOP found in Section 12.

3.1.1.3 Zero Gases are not certified to NIST standards but must meet specific requirements (See section 3.1.2.7) and operate in good working order.

3.1.1.4 Monitoring instrumentation must be an EPA reference or equivalent method meeting the requirements specified in 40 CFR Part 53 and 40 CFR Part 58 Appendix C.

3.1.2 Specifications for Calibration Standards, Zero Gases and Monitoring Instrumentation

3.1.2.1 Calibration gases to be diluted by means of a dynamic calibration system shall contain a known concentration of SO₂ in nitrogen.

3.1.2.2 The specific concentration of a calibration standard must be certified according to EPA traceability protocol. This must be stated on the purchase order when ordering calibration gases.

3.1.2.3 Sulfur dioxide concentrations to be diluted by means of a dynamic calibration system are to be within the range of 6 - 60 ppm SO₂ in nitrogen. FCEAP runs on a 0-100 ppb range. SO2 hourly levels at the Hattie Ave. site rarely exceed 10 ppb and the highest average we have seen over the last 7 years was 31ppb. Therefore, we feel comfortable operating at the 0-100 range. The lower range also gives finer definition to the low ambient values we typically measure.

3.1.2.4 SO2 concentrations used for multi-point verifications/calibrations are produced by a verified calibration standard calibrator. Multi-point calibrations consist of a zero and 4 upscale points, the highest being a concentration of 80%-90% of the calibration scale range of the analyzer. The points are listed below.

Point 1: 0 ppb SO₂ (Zero) Point 2: 90 ppb SO₂ (Span) Point 3: 70 ppb SO₂ (Mid-point) Point 4: 40 ppb SO₂ (Precision) Point 5: 30 ppb SO₂ (Low-point)

Section 3 SOP for SO2 May 2016 Page 6 of 35 Revision 1

3.1.2.5 Audit concentrations must be produced by a system independent of the routine calibration system. A minimum of zero and three upscale points should be chosen to bracket 80% of the ambient data if at all possible. The points chosen must be in the following ranges, contained within the operational range that the FCEAP uses, which is 0-100 ppb. For FCEAP, two of the points chosen must be in the two required levels in the following ranges. Additional points can be added and run in any other level.

Level 1: 0.3-2.9 ppb SO2 Level 2: 3.0-4.9 ppb SO2 (required) Level 3: 5.0-7.9 ppb SO2 Level 4: 8.0-19.9 ppb SO2 Level 5: 20.0-49.9 ppb SO2 Level 6: 50.0-99.9 ppb SO2 (required) Level 7: 100.0-149.9 ppb SO2 (Over FCEAP range) Level 8: 150.0-259.9 ppb SO2 (Over FCEAP range) Level 9: 260.0-799.9 ppb SO2 (Over FCEAP range) Level 10: 800.0-1000.0 ppb SO2 (Over FCEAP range)

Audit standards must be independent of the standards used for calibrations/verifications.

3.1.2.6 Sulfur dioxide concentrations used to perform precision checks must be in the range of 5-80 ppb SO₂.

3.1.2.7 Zero air to be used for calibrations, 90-day verifications, bi-weekly Zero/Span/Precision (ZSP) checks, nightly auto-calibrations, and audits must be free of contaminants, which will cause a detectable response on the SO2 analyzer. The zero air should contain < 1.0 ppb of SO2. A series of drierite columns or similar containers loaded with purafil, silica gel, charcoal, hopcalite, and molecular sieve is used to scrub compressed air. The compressed air is routed through a 5 μ m Teflon filter.

Audit zero air is provided by a pump (diaphragm or oil-less piston) moving air through a series of scrubbers. The audit zero air is dried with silica gel, then scrubbed through purafil and charcoal. The audit zero air is finally filtered through a 5 μ m particulate filter.

3.1.3 Gas Standard and Initial Instrument Checks

3.1.3.1 Upon receipt of gases, check to ensure that the certificate of analysis is included with each cylinder.

Section 3 SOP for SO2 May 2016 Page 7 of 35 Revision 1

3.1.3.2 Check the concentration on the cylinder label against the concentration on the certificate for each cylinder.

3.1.3.3 Thoroughly check each gas cylinder to ensure that all specifications have been met by running a ZSP check on an up to date, calibrated, analyzer. Reject any gases that do not pass specifications and return them to the supplier.

3.1.3.4 Upon receipt of cylinder gas standards the following information must be clearly marked on the cylinder by affixing a tag to the cylinder:

- a: ID Reference Number
- b: Cylinder contents
- c: Cylinder concentrations
- d: Analysis and Expiration date
- e: Cylinder usage (i.e. cal, span, precision, etc.)

Cylinder standards must not be used after the expiration date until recertified.

3.1.3.5 SO2 instrumentation must meet the requirements of the Technical Assistance Document for Precursor Gas Measurements (EPA -454/R-05-003, September 2005) or be an equivalent method as described in 40 CFR, Part 53. A list of EPA designated reference and equivalent methods is available from EPA.

- a: An EPA designation sticker must be affixed to the instrument.
- b: A factory manual must accompany the instrument.
- c: A record or log (hardcopy) of all maintenance done to the analyzer must be kept in the pocket on top of the analyzer. Update digital copy on shared drive as well.
- d: Instrument must be tested and performance documented in the FCEAP master Excel spreadsheet containing all check records for network equipment. This document is located in the S:\A&M\Repair Supplies and Logs\Instruments checks folder and is called SO2 Analyzer In-Lab checks.xls. Below is the layout:

Section 3 SOP for SO2 May 2016 Page 8 of 35 Revision 1

Date	7/7/2015	Initials	RA				
Reason for	checks						
		This is a new in	strument, first check	after receiving instrum	ent.		
		Instrument	SN	0.			
Genera	ting	T700U	128				
Gas Cyli	nder	CC367593	112				
	zero 0	span 90	mid 70	prec 40	low 30		
enerate	0	92.3	72	39	29.2		
en. Ipm	3	3	4	4	4	4	
ad	-0.026	93.827	71.564	38.851	28.699		
tability	0.012	0.061	0.04	0.0984	0.016		
pb diff	-0.03	1.53	-0.44	-0.15	-0.50		
6 OS	78	-1.63	0.61	0.38	1.75		
		UN	Un	Un	UN		
Observa	tions						

After calibration, if 4% error tolerances are not met, inform the Program Manager and contact the manufacturer.

3.2 Initial Monitor Setup

3.2.1 Site Requirements

To ensure the uniform collection of air quality data, various siting criteria must be followed. 40 CFR 58 Appendix E outline these criteria. The criteria are summarized below for neighborhood spatial scales for SO2.

3.2.1.1 The sample inlet must be located 2-15 m above ground and a distance from the supporting structure > 1 m.

3.2.1.2 The probe inlet must be > 10 meters from the drip line of trees that are located between the urban city core and along the predominant summer daytime wind direction.

3.2.1.3 The distance from the probe inlet to any obstacles such as buildings must be at least twice the height the obstacle protrudes above the probe inlet.

3.2.1.4 There must be unrestricted airflow 270° around the inlet probe, or 180° if the probe is on the side of a building. The 270° arc must include the predominant wind direction, and for the

Section 3 SOP for SO2 May 2016 Page 9 of 35 Revision 1

Winston-Salem area, the primary wind direction is from the SW.

3.2.1.5 The sample line should be as short as practical and should be constructed of FEP Teflon.

3.2.1.6 If the above siting criteria cannot be followed, it must be thoroughly documented and a waiver requested from the Air, Pesticides and Toxics Management Division (APTMD) of the USEPA. A complete site evaluation including all dimensions, pictures, maps, and the monitoring objective should be prepared as the site is being set up. This documentation should be maintained in the annual monitoring network plan.

3.2.2 Monitor Installation - Thermo Model 43i-tle SO₂ Analyzer

3.2.2.1 The analyzer should be placed on a sturdy table or in an appropriately sized instrument rack.

3.2.2.2 The table or rack should be as vibration free as possible.

3.2.2.3 The analyzer must operate within the temperature range of 20 - 30 C.

3.2.2.4 A verified thermometer should be installed near the analyzer to observe temperature readings to insure that temperature criteria are met. It is polled and checked along with other data to make sure it falls within limits. Identify and correct problem if it is not within limits. The thermometer will be verified semi-annually to ensure proper function (Fig 1).



Figure 1: Site temperature device

3.2.2.5 Connect ambient air to be measured to the bulkhead connector labeled "SAMPLE" on the rear panel of the instrument. Care should be taken to see that dirty, wet, or incompatible materials in the sample lines do not contaminate the sample. Teflon tubing with an OD of 1/4" and a minimum ID of 1/8" is required for all sample lines. The length of the tubing should be held to a minimum.

3.2.2.6 Confirm that a $5-\mu m$ Teflon particulate filter is installed in the filter holder and the holder is connected to the sample line before the sample port.

3.2.2.7 Plug in analyzer into a surge protected power supply.

3.2.2.8 Turn on power switch.

Section 3 SOP for SO2 May 2016 Page 10 of 35 Revision 1

3.2.2.9 Check that the instrument is booting the firmware. Let it warm up for at least 1 hour. Use the menu on the front panel to check the instruments diagnostics. If the sample flow is outside its ranges, check for blockages, pump condition, and/or leaks.

3.2.2.10 Connect the calibration standard gas produced from the calibrator to the SO2 solenoid (Fig 2) valve that feeds SO2 calibrator concentrations to the sample probe box outside the building via a Teflon (FEP) line with OD of 1/4" and a minimum ID of 1/8". The transfer standard will send SO2 concentrations up the cal gas line into the probe box to a "tee". The tee is also connected to the short inlet line that goes to the inlet funnel and the sample feed going to the analyzer. In ambient operation the analyzer pulls ambient air from the inlet line and the cal gas line is sealed by the solenoid. In calibration operation the transfer standard supplies SO2 concentrations through the solenoid and cal gas line up to the probe box. The analyzer pulls what it needs through the sample line and the inlet line becomes the vent for the excess cal feed. The entire sample path except the short inlet line (less than 12") is used during all reportable QC/QA checks.



Figure 2: Plumbing behind the calibrator

Section 3 SOP for SO2 May 2016 Page 11 of 35 Revision 1

3.2.2.11 An ESC 8832 Datalogger is used as the Datalogger. The Thermo SO2 Analyzer is connected to the 8832 through an analog connection. Configurations for individual channels are programmed into the 8832 Datalogger, site computer, and Office polling computer. Refer to Section 11 Datalogger 8832 SOP for more information. Check that the Datalogger channel has been properly initialized as follows:

3.2.2.11.1 To Login into the 8832, open 'HyperTerminal' on the PC and connect to the 8832 through the appropriate COM port or by using the correct IP address.

Type Esc 'site ID' AQM to enter Login screen.

Site ID in the Forsyth County Network:

Clemmons Middle (CM) Hattie Avenue A (HA) Hattie Avenue B (HB) Peter's Creek (PC) Shiloh Church (SC) Union Cross (UC)

Press L (Login), type password, press Enter. Then press C (Configuration Menu), D (Configure (Data) Channels), C (Change Old Configuration). Press Enter to see the channel configurations.

3.2.2.11.2 Check the channel configuration entries (Fig. 3) to ensure that they correspond to the entries listed below:



Figure 3: 8832 SO2 channel configuration

Section 3 SOP for SO2 May 2016 Page 12 of 35 Revision 1

3.2.3 Analyzer Datalogger setup with iPort software

3.2.3.1 The analyzer should be programmed using the iPort software supplied from the manufacturer. Program the Long Records (LREC) to be 1 hour in length and the Short Records (SREC) to be 1 minute in length. See 43i-tle manual for details. Store both records for at least an 800 count to cover the necessary length of time between site visits.

3.2.4 Initial Analyzer Checks and Adjustment

3.2.4.1 Install 43i-tle into an instrument rack or place analyzer on a tabletop where the unit can run. Plug power cord into the 43i-tle and attach sample line to the sample port.

3.2.4.2 Turn power switch to 'ON'. The instrument will display the 'Power-Up' and 'Warm-Up' screens while the instrument is warming up and conducting self-tests. Let the instrument warm up for at least 1 hour.

3.2.4.3 Check the Gas Units. Press Menu, press Enter when arrow is next to "Gas Units". Set units to ppb.

3.2.4.4 Check the range. Press Menu and then arrow down to Range and press Enter. The range has the option of Single, Dual, or Autorange mode. Set to single range from 0-100 ppb.

3.2.4.5 Activate pressure and temperature correction. Actuate the "MENU" push button. Scroll to "INSTRUMENT CONTROLS". Choose "INSTRUMENT CONTROLS". Press "TEMP CORRECTION". Press enter if "TEMP CORRECTION" is off. This will turn on the "TEMP CORRECTION". To exit this menu after setting "TEMP CORRECTION" on, press "MENU". Choose "PRESSURE CORRECTION". Set pressure correction to on and exit this choice as instructed above for "TEMP CORRECTION".

3.2.4.6 Check Flash Lamp. From the Main Menu choose Instrument Controls. Then choose Flash Lamp. The Flash Lamp must be off when using the optical test LED.

3.2.4.7 Check the Temperatures. From the main menu, scroll down to "DIAGNOSTICS" and hit enter. Then choose "TEMPERATURES". The Internal temperature should be between 8.0°C and 47.0°C. The Chamber Temperature should be between 43.0°C and 47.0°C.

3.2.4.8 Check the Pressure. When in "DIAGNOSTIC", choose "PRESSURE". The pressure should be >700 mmHG.

3.2.4.9 Check the Flow. When in the "DIAGNOSTIC" menu, choose "FLOW". The flow should be between 0.350 LPM and 1.500 LPM. The flow should be near 0.500 LPM.

3.2.4.10 Check the Intensity. From the "DIAGNOSTIC" menu, choose "LAMP INTENSITY". The acceptable range is 10,000 to 50,000 Hz.

Section 3 SOP for SO2 May 2016 Page 13 of 35 Revision 1

3.2.4.11 Perform a leak test in the sample mode by capping off the sample air inlet at the filter inlet fitting in the probe box on top of the site building. The pressure should drop to less than 200 Hg and the flow should read Zero. If not, the system has a leak. Trace each flow line and check all fittings for tightness. Retest. DO NOT PRESSURIZE THE SYSTEM.

3.2.4.12 After conducting steps within 3.1.3 and 3.2.4 under Initial Analyzer Checks and Adjustments the monitor can be placed into operation and a calibration performed.

3.3 Thermo Environmental Model 43i-tle SO₂ Analyzer Instrument Description

General Principals: Pulsating ultraviolet light is band-pass filtered and focused into a fluorescence chamber. Here, it excites SO₂ molecules into higher energy states. As these states decay the excited SO₂ molecules emit a characteristic radiation. A second filter allows only this radiation to fall on a photomultiplier tube, which turns the radiation into an electrical signal. This signal is then filtered and amplified by the electronics to levels appropriate for display. The physics of SO₂ fluorescence, the linearity of the photomultiplier tube, and good instrument design ensure that this signal is linearly proportional to the SO₂ concentration. For a better understanding of the analyzer, read the manual before operating the instrument.

3.4 Calibrations/Verifications of a Thermo 43i-tle SO2 Analyzer

SO2 analyzers are to be calibrated upon receipt, when installed, if moved from current location, and when certain repairs are made. An adjusted calibration may be necessary if an analyzer malfunctions and is repaired, or if power is lost for more than 24 continuous hours at a site.

An Adjusted Calibration, during which the lowest point (Zero) and the highest point (Span) are adjusted on the analyzer itself, is used at the start of sample collections for a site, and/or when a biweekly ZSP check or 90 day verification fails. The resulting slope and intercept values are automatically stored in the instruments memory. In addition, a new slope and intercept will be calculated comparing the analog voltage (from the instrument) and the engineering units output from the 8832 datalogger in the Excel-based site logbook (fig. 5). This updated slope and intercept will be entered into the 8832. The adjusted calibration resets the performance check (Bi-weekly Zero/Span/Precision) schedule, starting with the performance date of the Adjusted Calibration.

During a 90 day verification (multipoint check - 4 points plus a zero) the results are recorded in "as found" condition. The 90 day verification does not reset the Bi-weekly Zero/Span/Precision (ZSP) schedule. The (ZSP) will remain on its previous schedule.

3.4.1 Adjusted Multi-Point Calibration

Section 3 SOP for SO2 May 2016 Page 14 of 35 Revision 1

3.4.1.1 Typically the only time a Calibration is performed will be at the beginning of the analyzer's field operation or after certain maintenance or repairs.

A calibration must be performed if a 90-day verification or bi-weekly zero/span/precision (ZSP) check fails and the instrument is in good working order. Normally if either of these checks fail there is some problem within the monitoring system that needs addressing. If the Zero check is outside $\geq \pm 0.005$ ppm of known 0.000 or the Span check $\geq \pm 10\%$ of expected value, then an adjusted calibration will be done AFTER equipment failure is diagnosed, repaired, and instrument cleared for normal operation. If a typical slow drift causes the check to fail, no maintenance may be necessary but check with the program manager before proceeding.

3.4.1.2 Allow sufficient time for the SO2 analyzer and the calibration standard to warm up (~1 hour) as necessary, if they are not already on.

3.4.1.3 Always, if no major malfunctions have occurred and the monitor has been in normal operation, perform a bi-weekly zero/span/precision (ZSP) check prior to a calibration. If necessary, after the ZSP check, install a clean 5-µm particulate filter in the monitor filter holder in the probe line box on the roof of the site. Perform a system leak check (refer to 43i-tle manual) after replacing the filter and saturate the probe system with SO2 by running a SO2 span point (90 ppb). Record all information in the Excel-based site logbook (fig. 5), EDAS site logbook (fig. 15), and EDAS Digitrend graph.

3.4.1.4 Login to the 8832 using HyperTerminal.

Refer to Section 11 Datalogger 8832 SOP for more information.

Type Esc (two letter site ID) AQM Enter, to enter Login screen.

ESC 8832 v3.02 ID:HA Home Menu 11/06/14 14:01:50

H Help Screen

L Login / Set User Level

O Log Out / Exit

Press L to Login, type password, press Enter. C (Configuration Menu), D (Configure (Data) Channels), C (Change Old Configuration). Press M (Disable/Mark Channel Offline). Use arrows to skip to SO2, then, press Enter to disable the SO2 channel. (Fig. 4)

Section 3 SOP for SO2 May 2016 Page 15 of 35 Revision 1

😤 HA 8832 - HyperTerminal	- 🗆 🗡
Ele Edt View Call Iransfer Help	
ESC 8832 v3.02 ID:HA Real-Time Engineering Flags 07/30/15 10:41:4	9
	_
S02= 78.05 (D)	
NO = 0.0001023)	
0ZONE= 56.55 ()	
_ 03CAL= 0.7871 ()	
SIMP= 25.58 ()	
NU2PREL= 0.0879 ()	
038HR= 56.57 ()	
03-W126= 0.05657 ()	
K1ZEROAN=-10.4_ ()	
K3SPHNHN= 221.5 ()	
KOPRECHN= 66.32 ()	
ESC or SPOCE to ovit	
Connected 0:15:50 VT100 9600 8-N-1 SCROLL CAPS NUM Capture Print echo	

Figure 4: SO2 Channel Disabled

3.4.1.5 Prepare a calibration worksheet in the instrument logbook containing the following entries:

Date/Time; Operator; Site/AQS ID; Datalogger check; Analyzer and Calibrator Make/Model/Serial Number/Diagnostics; SO2 Operational checks and SO2 Readings

The following example of the electronic data sheet (Fig. 5) will be used to document checks.

				_		27		THURSHEEL	_				
SITE	HA	DATE:	2/25/2016		ANALYZER:	43i-TLE	816230552	Site Calibra	tor - API 700EU:	616-s		OPERATOR:	JRB
				1		Model Number	Serial Number			Serial Number	Last MFC Cert.		
ZERO AIR	API 17018	60	29			11/20/2015	2/2/2015	CALIBRATI	ON CYLINDER-	CC367593	12.72	500	8/9/15
		SERIAL #	PSI	Date of Last Maint.		Last Verification	Last Calibration		1	NUMBER	PPM	PRESSURE	EXP DATE
												CONTRACTOR OF THE OWNER	
					Current Coeff (slope):	0.959		New Coeff (slope):	0.954				
					Current Background (offset):	1.4	10	New Background (offset):	1.6				
					*	Slope and C	ffset From .	Analyzer*					
1	SO2	SO2	AIR	AIR	EXPECTED	OBSERVED	OBSERVED	CORRECTED	CORRECTED			43i-tle Diag	nostics
	FLOW	FLOW	FLOW	FLOW	SO2 PPB	DAS RAW	APIRAW	DAS	API	% DIFF-	% DIFF	Pressure	714.7
	Actual	Target	Actual	Target	Y	Voltage-DC	292	PPB	PPB	DAS	API	Internal Temp	31.1
1	0	0	3.000	2,997	0.000	0.0002	-0.0040	-0.050	-0.021	#N/A	#N/A	Chamber Temp	45.0
2	0.0213	0.0213	2,979	2.991	90	0.9001	90.057	90.038	90.058	0.04	0.06	Flow	0.498
3	0.0276	0.0277	4.972	4.983	70	0.6987	69-875	69.876	69.872	+0.18	-0.18	Lamp Intensity	89%
4	0.0220	0.0222	6.978	6.984	40	0.4014	46.090	40.114	40.081	0.28	0.20		
5	0.0165	0.0164	6.983	6.969	30	0.3006	39,017	30.023	30.006	0.08	0.02		
										All points must be	e less than 4% diff.		
		ana ai	DAS	an and t	LIMITS				S	API RECORDS		LIMITS	
	XI Y:	slope =	100.1092	OK	98 <= M <= 102				X2 Y:	slope =	1.0002	0.9500 <= M <= 1.200	
	XI Y:	intercept =	-0.0703	OK	≈ 0.50 <= B <= 0.50				X2 Y:	INTERCEPT =	-0.0172	• 0.50 <= B <= 0.50	
	X1 Y:	R2 =	1.0000	OK	R2 >= 0.9990				X2 Y:	R2 =	1.0000	R2 >= 0.9990	
				-						Comments:			
		10	a lateral di lateral di	ALL LINEAR R	EGRESSION VALUES WITH	IN SOP LIMITS	YES	2010/00/0					
			NEW DA	S SLOPE / INTERC	EPT ENTERED INTO DATA	A LOOGER AT	11:52 AM	2/25/2016					
\$007/461h-	0.0002.32						lune	Date					
1614 02.26	15 flags 1000	0000 +02 -0.00	4										
10.11 00.00	to migo reco												
SO2 (A01)=	0.9001 V												
15:40 02-25-1	15 flags 4C00	00000 502 90.05	57										
1.0114.001	000020000												
SO2 (A01)=	0.6987 V												
15:53 02-25-1	15 flags 4C00	0000 so2 69.8	75										
SO2 (A01)=	0.4014 V												
16:01 02-25-1	15 flags 4C00	00000 502 40.09	00										
			8										
SO2 (A01)=	0.3006 V												
	15 flags 40'00	0000 so2 30.01	17										

Figure 5: Instrument Logbook, Calibration Worksheet

3.4.1.6 Verify that the analyzer is working within specifications (see 3.2.4.5-3.2.4.11). Connect to the analyzer using iPort software. Open iPort and click the connect button. The simulator of the 43i-tle should show up on the screen. (Fig. 6)

Section 3 SOP for SO2 May 2016 Page 16 of 35 Revision 1



Figure 6: iPort Simulator

3.4.1.7 Record the diagnostic observations in the logbook. If these specifications are not met consult the instrument instruction manual for corrective action.

3.4.1.8 Verify the output of the Gas Dilution System (Calibrator) is connected to the SO2 solenoid so gas is supplied to the sample line of the monitor to be calibrated. See section 3.2.2.10.

3.4.1.9 Using the Gas Dilution System (Calibrator), run the 'SO2 ZERO' sequence. This sequence is programmed (Fig. 7) into the 700EU Calibrator and will supply zero air to the 43i-tle.

Section 3 SOP for SO2 May 2016 Page 17 of 35 Revision 1



Figure 7: Calibrator Sequence Program

3.4.1.10 Verify zero air is making it into the 43i-tle. Readings should drop near zero within 30 seconds.

3.4.1.11 Allow the Model 43i-tle to sample zero air until a stable reading is obtained, at least 15 minutes, by checking the SO2 stability channel on the 8832. It needs to be less than 1 ppb. Take the analyzer out of Remote Mode and put it in Local Mode, by pressing the Enter button when on the Main Screen. Then go to the Main Menu, press the Menu button. From the Main Menu choose Calibration. From the Calibration menu choose Calibrate Zero. In the Calibrate Zero screen, press ENTER to set the SO2 reading to zero. Allow the SO2 stability channel to fall below 1 ppb again after adjustment.

Note: Make sure the analyzer is placed back in Remote Mode when finished with the calibration by pressing the Enter button again when on the Main Screen.

3.4.1.12 After stability is good, collect instantaneous snapshot of the voltage reading from the 8832 and a minute average (SREC) from the analyzer. Use iPort to retrieve the SREC from analyzer by going to the simulator and click 'TERM' for the terminal screen. The "TERM" button toggles from "GRAPH" to "TERM" when it is pressed. Type in 'SREC' beside "43i->" and hit enter. Copy the SREC string (Fig. 8) and paste it into the Excel logbook.

Section 3 SOP for SO2 May 2016 Page 18 of 35 Revision 1



Figure 8: iPort Simulator SREC String

3.4.1.13 Using the Gas Dilution System (Calibrator), run the 'SO2 90' sequence (Fig. 9). This sequence is programmed into the 700EU Calibrator and will supply a concentration of 90 ppb of SO2 to the 43i-tle. Allow the instrument to come to a stable reading. It may require 10 to 30 minutes for the point to stabilize.



Figure 9: Calibrator Sequence Cycle Through/Selection

3.4.1.14 From the Main Menu choose Calibration. From the Calibration menu choose Calibrate Span. The first line of the display shows the current SO₂ concentration reading. The second line of the display shows the SO₂ range and the third line is where the SO₂ concentration is entered. Enter the SO₂ calibration gas concentration using the \uparrow , \downarrow , \leftarrow , and \rightarrow pushbuttons. Press ENTER to calibrate the SO₂ reading to the SO₂ calibration gas.

Section 3 SOP for SO2 May 2016 Page 19 of 35 Revision 1

3.4.1.15 After stability is good (< 1 ppb), collect instantaneous snapshot of the voltage reading from the 8832 and a minute average (SREC) from the analyzer. Use iPort to retrieve the SREC from analyzer by typing 'SREC' beside "43i->" and hit enter. Copy the result string and paste it into the Excel logbook.

3.4.1.16 Using the Gas Dilution System (Calibrator), run the 'SO2 70' sequence. This sequence is programmed into the 700EU Calibrator and will supply a concentration of 70 ppb of SO2 to the 43i-tle. Allow the instrument to come to a stable reading. It may require 10 to 30 minutes for the point to stabilize. After stability is good (< 1 ppb), collect instantaneous snapshot of the voltage reading from the 8832 and a minute average (SREC) from the analyzer. Use iPort to retrieve the SREC from analyzer by typing 'SREC' beside "43i->" and hit enter. Copy the result string and paste it into the Excel logbook.

3.4.1.17 Using the Gas Dilution System (Calibrator), run the 'SO2 40' sequence. This sequence is programmed into the 700EU Calibrator and will supply a concentration of 40 ppb of SO2 to the 43i-tle. Allow the instrument to come to a stable reading. It may require 10 to 30 minutes for the point to stabilize. After stability is good (< 1 ppb), collect instantaneous snapshot of the voltage reading from the 8832 and a minute average (SREC) from the analyzer. Use iPort to retrieve the SREC from analyzer by typing 'SREC' beside "43i->" and hit enter. Copy the result string and paste it into the Excel logbook.

3.4.1.18 Using the Gas Dilution System (Calibrator), run the 'SO2 30' sequence. This sequence is programmed into the 700EU Calibrator and will supply a concentration of 30 ppb of SO2 to the 43i-tle. Allow the instrument to come to a stable reading. It may require 10 to 30 minutes for the point to stabilize. After stability is good (< 1 ppb), collect instantaneous snapshot of the voltage reading from the 8832 and a minute average (SREC) from the analyzer. Use iPort to retrieve the SREC from analyzer by typing 'SREC' beside "43i->" and hit enter. Copy the result string and paste it into the Excel logbook. Return Calibrator to 'Standby" mode and place analyzer back in remote mode.

3.4.1.19. The percent difference for each point must be $< \pm 2.0\%$.

3.4.1.20 Review the linear regression results for SO₂ calculated in the calibration worksheet between the expected SO₂ and the observed SO₂ from the 8832. The linear regression line should meet the following specifications in order to be valid for reporting ambient air data: $98 \le m \le 102$, $-2.0 \le b \le 2.0$, and $r_2 \ge 0.9990$ (the logger slope and intercept translates the raw voltage into engineering units for the data logger). If the line does not meet these specifications inform the Program Manager. If specifications are met, enter the new slope and intercept into the SO₂ channel configuration in the 8832.

3.4.1.21 Review the linear regression results for SO₂ calculated in the calibration worksheet between the expected SO₂ and the observed SO₂ from the 43i-tle. The linear regression line should meet the following specifications in order to be valid for reducing ambient air data: 0.9800 < slope < 1.0200, -2.0 < intercept < 2.0, and $r \ge 0.9990$ (the analyzer slope and intercept adjusts a ppb value to a corrected ppb value based on a best fit line across the five points). If the line does not meet these specifications inform the Program Manager. If specifications are met,

Section 3 SOP for SO2 May 2016 Page 20 of 35 Revision 1

the new slope and intercept can be applied to any value stored in the internal datalogger in the analyzer if data is lost from the 8832.

3.4.1.22 If the above criteria cannot be met inform the Program Manager. If the criteria are met proceed with next step.

3.4.1.23 Open and label the Digitrend SO2 graph stored on the site computer with a memo stating what was done and look at the trace to verify points were flat and display a good "stair-step" appearance.

3.4.1.24 Verify Calibrator is in 'Standby' mode. This will allow the sample line to sample ambient air once again. Confirm analyzer is readings ambient levels once again within three minutes. If slow to return run a final zero to test for drift and flush line.

3.4.1.25 Once analyzer is reading ambient levels again, enable the data logger channel by returning to the 'CONFIGURATION MENU'.

3.4.1.25.1 Click on 'Configure Data Channels'

3.4.1.25.2 Click on 'Enable/Mark Channel Online'

3.4.1.25.3 Select channel to be enabled. Press Enter to enable the channel. The SO2 channel is now online.

3.4.2 SO2 90-day Verification

3.4.2.1 An SO2 90-day verification check must be done at least once every 90 days. Run the following points: 0 (Zero), 90 (Span), 70, 40 (Prec), and 30 ppb and verify results are all within 10% difference. This is to verify everything is running properly in an "as found" state. This check does not replace nor reset the bi-weekly ZSP check schedule.

3.4.2.2 Verify last auto-cal results from the night before are within tolerance (10%) and confirm everything is running properly. If they are not, contact the program manager.

3.4.2.3 Login to the 8832 using HyperTerminal.

3.4.2.4 Disable the SO2 channel.

Refer to Section 11 Datalogger 8832 SOP for more information.

Type Esc (two letter site ID) AQM Enter, to enter Login screen.

ESC 8832 v3.02 ID:HA Home Menu 11/06/14 14:01:50

H Help Screen

L Login / Set User Level

O Log Out / Exit

Section 3 SOP for SO2 May 2016 Page 21 of 35 Revision 1

Press L to Login, type password, press Enter. C (Configuration Menu), D (Configure (Data) Channels), C (Change Old Configuration). Press M (Disable/Mark Channel Offline). Use arrows to skip to SO2, then press Enter to disable the SO2 channel.

3.4.2.5 Prepare a 90-day Verification worksheet in the instrument logbook containing the following entries:

Date/Time; Operator; Site/AQS ID; Datalogger check; Analyzer and Calibrator Make/Model/Serial Number/Diagnostics; SO2 Operational checks and SO2 Readings

The following example of the electronic data sheet (Fig. 10) will be used to document checks. All information fields listed above must be included.

						SO2	90-day Verificat	ion Worksheet					
SITE:	HA	DATE	2/25/2016	- 	ANALYZER.	43i-TLE Model Number	816230552 Serial Number	Site Calib	beator - API 700EU:	616-s Serial Number	Last MPC Cert.	OPERATOR:	JRB
ZERO AIR	/API T701H:	60 SERIAL #	29 PSI	Date of Last Maint.		11/20/2015 Last Verification	2/2/2015 Last Calibration	CALIBRA	TION CYLINDER:	CC367593 NUMBER	12.72 PPM	500 PRESSURE	8W15 EXP DATE
					Ctar Current Bo *	rent Coeff (slope); ckground (offset); Slope and O	0.959 1.4 Offset From A	nalvzer*					
	SO2	SO2	AIR	AIR	EXPECTED	OBSERVED	OBSERVED	CORRECTED	CORRECTED			43i-tle Diag	nostics
	FLOW	FLOW	FLOW	FLOW	SO2 PPB	DAS RAW	APIRAW	DAS	API	% DIFF-	% DIFF	Pressure	714.7
	Actual	Target	Actual	Target	Y	PPB	1998	PPB	PPB	DAS	API	Internal Temp	31.1
11	0	0	3.000	2.997	0.000	0.0421	-0.0040	-0.108	-0.021	#N/A	IIN/A	Chamber Temp	45.0
2	0.0213	0.0213	2.979	2.991	90	90.17	90.057	89.921	90.058	-0.09	0.06	Flow	0.498
3	0.0276	0.0277	4.972	4.983	70	70.25	69.875	70.023	69.872	0.03	-0.18	Lamp Intensity	89%
- 4	0.0220	0.0222	6.978	6,954	40	40.21	40.090	40.016	40.081	0.04	0.20		
5	0.0165	0.0164	6,983	6.969	30	30.32	30.017	30.137	30.005	0.46	0.02		
										All points must be	less than 10% diff.		
	Ú.,		DAS		LIMITS					APIRECORDS		LIMITS	
	XI Y:	slope =	0.9989	OK	98 <= M <= 102				X2 Y:	slope =	1.0002	0.9500 <= M <= 1.200	
	XLY:	intercent =	-0.1496	OK	• 0.50 <= B <= 0.50				X2 Y:	INTERCEPT =	+0.0172	= 0.50 <= B <= 0.50	
	XI Y:	R2 =	1.0000	OK	R2 >== 0.9990				X2 Y:	R2 =	1.0000	R2 >= 0.9990	
502-0.4104	(P)			ALL LINEAR RE	ORESSION VALUES WITH	IN SOP LIMITS?	YES			Adjusted Calib	ration done due to floo equipment rem	r replacement being completed oved while work was done.	in building and all
13-35 11-05-15	flags #C0000	00 so2 0.027											
SO2 (A01)= 15:40 02-25-	0.9001 V 15 flags 4C0	00000 so2 90.0	57										
502 (A01)e	0.6987 V												
15:53 02-25-	15 flags 4C0	00000 so2 69.8	75										
SO2 (A01)- 16:01 02-25-	0.4014 V 15 flags 4C0	00000 so2 40.0	90										
SO2 (A01)=	0.3006 V 15 flags 4C0	00000 soZ 30.0	17										

Figure 10: Instrument Logbook, 90-day Verification Worksheet

3.4.2.6 Verify that the analyzer is working within specifications (see 3.2.4.5-3.2.4.11). Connect to the analyzer using iPort software. Open iPort and click the connect button. The simulator of the 43i-tle should show up on the screen. (Fig. 6)

3.4.2.7 Record the diagnostic observations in the logbook. If these specifications are not met consult the instrument instruction manual for corrective action.

3.4.2.8 Verify the output of the Gas Dilution System (Calibrator) is connected to the SO2 solinoid so gas is supplied to the sample line of the monitor to be verified. See section 3.2.2.10.

3.4.2.9 Using the Gas Dilution System (Calibrator), run the 'SO2 ZERO' sequence. This sequence is programmed into the 700EU Calibrator and will supply zero air to the 43i-tle.

Section 3 SOP for SO2 May 2016 Page 22 of 35 Revision 1

3.4.2.10 Verify zero air is making it into the 43i-tle. Readings should drop near zero within 30 seconds.

3.4.2.11 Allow the Model 43i-tle to sample zero air until a stable reading is obtained, at least 15 minutes, by checking the SO2 stability channel on the 8832. It needs to be less than 1 ppb.

3.4.2.12 After stability is good, collect instantaneous snapshot of the ppb reading from the 8832 and a minute average (SREC) from the analyzer. Use iPort to retrieve the SREC from analyzer by going to the simulator and click 'TERM' for the terminal screen. The "TERM" button toggles from "GRAPH" to "TERM" when it is pressed. Type in 'SREC' beside "43i->" and hit enter. Copy the SREC string (Fig. 5) and paste it into the Excel logbook.

3.4.2.13 Using the Gas Dilution System (Calibrator), run the 'SO2 90' sequence. This sequence is programmed into the 700EU Calibrator and will supply a concentration of 90 ppb of SO2 to the 43i-tle.

3.4.2.14 Allow the instrument to come to a stable reading. It may require 10 to 30 minutes for the point to stabilize.

3.4.2.15 After stability is good (< 1 ppb), collect instantaneous snapshot of the ppb reading from the 8832 and a minute average (SREC) from the analyzer. Use iPort to retrieve the SREC from analyzer by typing 'SREC' beside "43i->" and hit enter. Copy the result string and paste it into the Excel logbook.

3.4.2.16 Using the Gas Dilution System (Calibrator), run the 'SO2 70' sequence. This sequence is programmed into the 700EU Calibrator and will supply a concentration of 70 ppb of SO2 to the 43i-tle. Allow the instrument to come to a stable reading. It may require 10 to 30 minutes for the point to stabilize. After stability is good (< 1 ppb), collect instantaneous snapshot of the ppb reading from the 8832 and a minute average (SREC) from the analyzer. Use iPort to retrieve the SREC from analyzer by typing 'SREC' beside "43i->" and hit enter. Copy the result string and paste it into the Excel logbook.

3.4.2.17 Using the Gas Dilution System (Calibrator), run the 'SO2 40' sequence. This sequence is programmed into the 700EU Calibrator and will supply a concentration of 40 ppb of SO2 to the 43i-tle. Allow the instrument to come to a stable reading. It may require 10 to 30 minutes for the point to stabilize. After stability is good (< 1 ppb), collect instantaneous snapshot of the ppb reading from the 8832 and a minute average (SREC) from the analyzer. Use iPort to retrieve the SREC from analyzer by typing 'SREC' beside "43i->" and hit enter. Copy the result string and paste it into the Excel logbook.

3.4.2.18 Using the Gas Dilution System (Calibrator), run the 'SO2 30' sequence. This sequence is programmed into the 700EU Calibrator and will supply a concentration of 30 ppb of SO2 to the 43i-tle. Allow the instrument to come to a stable reading. It may require 10 to 30 minutes for the point to stabilize. After stability is good (< 1 ppb), collect instantaneous snapshot of the ppb reading from the 8832 and a minute average (SREC) from the analyzer. Use iPort to retrieve the SREC from analyzer by typing 'SREC' beside "43i->" and hit enter.

Section 3 SOP for SO2 May 2016 Page 23 of 35 Revision 1

Copy the result string and paste it into the Excel logbook. Return Calibrator to 'Standby' mode and place analyzer back in remote mode.

3.4.2.19. The percent difference for each point must be $< \pm 10.0\%$.

3.4.2.20 If the above criteria cannot be met inform the Program Manager. If the criteria are met proceed with next step.

3.4.2.21 Open and label the Digitrend SO2 graph stored on the site computer with a memo stating what was done and look at the trace to verify points were flat and display a good "stair-step" appearance.

3.4.2.22 Verify Calibrator is in 'Standby' mode. This will allow the sample line to sample ambient air once again. Confirm analyzer is readings ambient levels once again. If slow to return run a final zero to test for drift and flush line.

3.4.2.23 Once analyzer is reading ambient levels again, enable the data logger channel by returning to the 'CONFIGURATION MENU'.

3.4.2.23.1 Click on 'Configure Data Channels'

3.4.2.23.2 Click on 'Enable/Mark Channel Online'

3.4.2.23.3 Select channel to be enabled. Press Enter to enable the channel. The SO2 channel is now online.

3.5 Teledyne API 701 Zero Air Generator, Teledyne API T701H Zero Air Generator

A zero air system to be used in the field should be constructed as follows: a zero air generator, a valve connected to the output that is connected to two drying columns filled with fresh silica gel followed by a column of activated charcoal containing a layer of Purafil, the air is then passed through a 5 μ m teflon filter to remove particulate.

3.5.1 A check of the zero air system should be performed annually.

3.5.2 Annually, the entire zero air system, including the zero air generator and drying columns, should be brought back to the laboratory.

3.5.3 At this time, replenish the drying column with fresh silica gel, activated charcoal, and fresh Purafil. Replace the filter at this time.

3.5.4 Replace the filter on rear of zero air generator. Check the canisters for leaks before reinstalling them into the generator.

3.5.5 After the annual maintenance is completed, attach the zero air to a flow certified calibrator.

3.5.6 Prepare to run a zero point with the calibrator to an analyzer.

Section 3 SOP for SO2 May 2016 Page 24 of 35 Revision 1

3.5.7 Let the analyzer stabilize and observe the SO2 value which should read \pm .002 ppm of zero. If not, contact the Program Manager for how to proceed.

3.6 Thermo Environmental Model 43i-tle Maintenance

This section describes the periodic maintenance procedures that should be performed on the monitor to ensure proper, uninterrupted operation. Frequency of maintenance and service checks is indicated in each procedure.

3.6.1 Inspection of Pressure Reducing Capillary

Inspect and clean or replace the pressure reducing capillary - To ensure that the pressure reducing capillary is not dirty and does not impair the flow of sample gas through the instrument, it should be inspected approximately annually or as needed. The following procedure should be used:

3.6.1.1 Remove the instrument cover.

3.6.1.2 Locate capillary holder at top of flow meter and remove the cap nut.

3.6.1.3 Remove glass capillary (long – 13 mil) and "O" ring.

3.6.1.4 Check the capillary for particulate deposits within the bore. Clean or replace capillary (Part No. 8919) if particulate deposits are present.

3.6.1.5 Check "O" ring (Part No. 4800) for cuts or abrasions and replace if either are present.

3.6.1.6 Replace capillary in holder, making sure "O" ring is around capillary before inserting it into the holder.

3.6.1.7 Tighten holder cap over capillary enough to insure a tight seal.

3.6.2 Fan filter inspection and cleaning

Fan filter inspection and cleaning. Under normal use, the filter over the instrument fan located on the rear panel of the instrument should be cleaned and reconditioned at six-month intervals.

3.6.2.1 Remove the filter cover by gently pulling it off the fan guard.

3.6.2.2 Flush the filter with warm water or use a can of air to blow the dirt off the filter.

3.6.2.3 Re-install the filter and filter cover.

Section 3 SOP for SO2 May 2016 Page 25 of 35 Revision 1

3.6.3 Particulate Filter Inspection

Sample particulate filter inspection is necessary every site visit (Fig 11). The filter should be inspected and for excessive dust and particulates, which restrict flow. Filters should be replaced once a month and a leak check performed (3.2.4.11). All filter replacements should be done AFTER a Quality control (QC) Zero-Span-Precision (ZSP) 14 day check.



Figure 11: Sample box filter housing

3.6.4 Flow check.

A flow rate of about 0.5 LPM should be observed for a standard instrument, if a flow rate of less than 0.35 LPM is observed by an audit instrument during annual maintenance, perform a leak check (3.2.4.11) and any other troubleshooting that may be necessary to fix the problem, i.e inspect pump flapper and diaphragm.

Preventive	reventive Maintenance Log for a 43i TLE				Maintenance Performed and completed					
Site:	Serial #:				Date	By	Notes			
Check all el	lectrical connections									
Check all p	neumatic connections									
Clean flow capillary										
Rebuild pur	mp									
Calibrate flo	ow									
Leak check										
Adjust Ana	log Outputs (Full Sca	le)								
Run test por	ints from calibrator to	adings								

Figure 12: Preventive maintenance log for a 43i-tle

Section 3 SOP for SO2 May 2016 Page 26 of 35 Revision 1

3.7 Routine site visits

3.7.1 Visit Requirements

3.7.1.1The purpose of the routine site visit is to ensure the analyzer and dataloggers are operating properly. The following should be performed on routine site visits conducted at least every two weeks and more frequently, if necessary.

3.7.1.2 Upon arrival, visually inspect the site to ensure sample line and probe are intact, moisture free, and that there are no problems such as tree branches growing too close to the sample inlet, insect nests interfering with the probe inlets, etc.

3.7.1.3 Verify the time (EST) on 8832 data logger, analyzer, and site computer.

3.7.1.5 Examine all the Digitrend graphs day by day and check for atypical data, such as questionable spikes, drops, excessive noise, and square waves in the trace. Record any discrepancies on the Digitrend graph and in the logbook if necessary. Document any discrepancies as soon as possible and maintain the documentation in the proper files and notify Program Manager.

3.7.1.6 If the monitor is operating within specifications, record the Lamp, PMT, Temperature, Pressure, Intensities and Flow in the logbook. Inspect the Digitrend graph. Ensure that the previous day's auto-calibration cycle is typical and that the hourly data is typical.

Corrective action should be taken if the zero is $> \pm 0.5$ ppb SO2 or the span is $> \pm 8\%$ from the expected value. Corrective action must be taken if the zero is $> \pm 1$ ppb SO2 or the span is $> \pm 10\%$ SO2 from the expected value.

Check and ensure that the sample line is connected to the sampling manifold and that it is not contaminated by dirt or moisture. Any possible abnormalities should be investigated to ensure continuous uninterrupted quality controlled data collection. If any problems are found the operator is to notify the supervisor and do whatever is necessary to permanently correct the problem. If the operator is not absolutely sure the problem encountered is permanently rectified, he should visit the site later that day or the next working day to check the problem. The operator is to keep the supervisor informed on a daily basis as to the status of the problem. Detailed records of all corrective actions are to be maintained in the logbook.

3.8 Quality Assurance/Quality Control checks

Quality Assurance (QA)/Quality Control (QC) procedures include performance audits, 90-day verification checks, zero-span-precision (ZSP) 14-day checks, and calibration checks.

Section 3 SOP for SO2 May 2016 Page 27 of 35 Revision 1

3.8.1 Performance Audit procedure

Audits are to be performed quarterly at a frequency ≤ 90 days apart. Analyzer accuracy audits are to be performed by an individual other than the analyst who performed the calibration. The QA staff performing the audit should also inspect the site's overall condition and report any issues to the Program Manager. Issues can include but not be limited to: safety hazards, operator oversights, EPA site requirements being met, building condition, overall neatness, and up-to-date documentation of the site's activities. The audit should be conducted using a gas dilution system, certified NIST EPA protocol cylinder gas (6 – 60 ppm range so required low audit levels can be attained), and zero air system that are independent of the normal calibration system. The following procedure should be followed when conducting audits:

3.8.1.1. The analyzer audit is conducted by challenging the measurement system with a series of known concentrations of calibration gas. The audit field procedure is similar to the 90-day verification procedure except that different points can be run. The audit must include zero and at least one point taken from three of the ten ranges:

- Level 1: 0.03 2.9 ppb SO2 Level 2: 3.0 – 4.9 ppb SO2 (required) Level 3: 5.0 – 7.9 ppb SO2 Level 4: 8.0 – 19.9 ppb SO2 Level 5: 20.0 – 49.9 ppb SO2 Level 6: 50.0 – 99.9 ppb SO2 (required) Level 7: 100.0 – 149.9 ppb SO2 (over-range for our monitor) Level 8: 150.0 – 259.9 ppb SO2 (over-range for our monitor) Level 9: 260.0 – 799.9 ppb SO2 (over-range for our monitor) Level 10: 800.0 – 1000 ppb SO2 (over-range for our monitor)
- 3.8.1.2 The audit is to be recorded in the audit section of the analyzer logbook. Figure 13 should be used for a template of data that must be recorded in the logbook. Record the information but do not alter the analyzer settings in any way.

Section 3 SOP for SO2 May 2016 Page 28 of 35 Revision 1

					0701			WORK	SHEET					
		на			0201	IE QUA	ATERLI AUDIT	05/27/2015	SHEET	-				
				10 C										
	500 0	37+0007+0022					ADDITION	LGA						
	Site analyzer	Thermo 43i-de	· · · · · ·				SITE YEAR	25.2						
	Site Calibrator Standard	TAPI 700EU 6	16-s	Cert Due	_		AUDIT STANDARD	API TTOOU SN	4: 128	CertDue	21219			
	DIAGNOSTICS:		-	-										
	431-De ANALYZER DIAGNOS	TICS:		0		_	T700U AUDIT STD DIA	NOSTICS:				1	ZERO AIR SYSTEM	
	502 ceef	0.954	Entered La	ighook Cumments	8		SERIAL NUMBER	128	2			Zero	Air Model: API T701H	
	Range	100	LRECS from	Albide Complete?			REG PRESSURE (PSIG)	8.1	1			Pres	sure (PSI): 28	
	aver Sme	60		UPS Checked?			BOX TEMP (DEG C)	33.7				Last	t Serviced:	
	Pressure	714.7	Pathe bo	Contraction Into Contra			CO GEN REF (WV)	0.0				Comments		
	Com	ON		Sile Cylinder OK?	÷.		OS LAMP TEMP (DEG. C)	48.0						
	Enternal Tens	311	502 channel en	labed after check?	¥		PHOTO MEASURE (MV)	4627.6	1					
	Flow	0.458					PHOTO FLOW (LPM)	0.8264				-		
	Lang Intensity	85%	3				PHOTOLAMP TEMP (DEG. C)	58.0						
	5						PHOTO STEMP (DEG. C)	43.0				AUD	T CYLINDER:	
MIN SE VARSYMMER: 92/75 MIN SE VARSYMER: 92/75	3	-					PHOTO SLOPE	0.5780					La 194304.	
	DATE OF LAST VERICAL	5/27/15	1				PHOTO OFFSET (PPB)	1.4000				Cost of the local division in the local divi	96,01 600,0000	
NUME NUME NUME COMMENTE 2379 2379 2379 COMMENTE 1001 1011 1011 1011 <	DATE OF LAST AUDIT	4/27/15	1				DIL PRESSURE (PSIG)	24.8				Record Deal	6023008	
Lick LUM 2.378 Collected 2.378 Collected Collected Collected Analyzer/s832 Data: Collected State Collected Collected State Collected State Collected State Collected State Collected State Collected State Collected State Stat							A-DIL (LPM)	3.0679				Passare	APPREX, JOH FIL	
COMMENTE ANALYZER/8832 DATA:	Secondaria III III III III III III III III III I	10.0					THORE (LPM)	2,9790	1					
ANALYZER:832 DATA:	COMMENTS:													
SOL 1000 CURRENT SLOPES AND INTERCEPTS ANALYZER/8832 DATA: CURRENT SLOPES AND INTERCEPTS ALDET SOL 100.1164 ALDET SULTS: SOL 100.1164 ALDET SULTS: SOL 100.015 SOL 100.01 SOL 100.01 SOL 100.01 SOL 100.00 SOL 0000 SOL 00000														
ANALYZER/8832 DATA: <u> </u>														
AVALYZER/8532 DATA: LURRENT BLOPES AND INTERCEPTS INTERCEPTS INTERCEPTS AUDIT RESULTS: SO2 SO														
Unit all presentent transmission Note that transmissin transmissin transmission <th c<="" td=""><td>ANALYZER/8832 D/</td><td>ATA:</td><td></td><td>-</td><td></td><td></td><td></td><td>-</td><td></td><td></td><td></td><td></td><td></td></th>	<td>ANALYZER/8832 D/</td> <td>ATA:</td> <td></td> <td>-</td> <td></td> <td></td> <td></td> <td>-</td> <td></td> <td></td> <td></td> <td></td> <td></td>	ANALYZER/8832 D/	ATA:		-				-					
					DAS	LOPES AND	API NAW SHEC							
No. A.102 A.0013 AUDIT RESULTS: Austantian Conservation (A.100)			SLOPE		100.3156		1.0130							
AUDIT RESULTS: DOC DOC AUR Austice Bits2 Addite Addite Addite Bits2 Addite Bits2 Addite Addite </th <th></th> <th></th> <th>NT .</th> <th></th> <th>-0.1052</th> <th></th> <th>-0.0013</th> <th></th> <th></th> <th></th> <th></th> <th></th> <th></th>			NT .		-0.1052		-0.0013							
AUDIT RESULTS. SOC AUX AUX Aux Aux Construction State State <thstate< th=""> State <thstate< th=""></thstate<></thstate<>	AUDIT DECUL TO													
FLOW Attail FLOW Tape: FLOW Prof. FLOW Prof. <thflow Prof. FLOW Prof. FLOW Pr</thflow 	NODIT RESULTS.	802	ATE	AIR	-	Audit Cal	8832	41/10	431-de	8832	431-54	8832	A Side	
Attail Taget Attail Taget PPB PPB PPB PPB PPB PPB OCC OCC 0.000 0.000 3.000 3.000 101.0 100.5 100.0 144.4 PBL OCC 0.000 0.0000 0.0000 2.964 3.099 190.0 100.5 190.5 141.52 0.250 0.560 OCK OK 0.0000 0.0000 2.964 3.099 190.0 100.5 190.5 141.52 0.250 0.060 OK	FLOW	FLOW.	FLOW	FLOW	Aude	Generate	OBS DAS	RAW	088	% DIFF	% DIFF	Audit	Audit	
0.000 0.000 3.000 3.000 3.000 0.0002 0.3 0.1000 FMA BHA OK OK 0.0000 0.0080 2.964 3.009 100.0 100.5 100.3 101.6025 0.58 OK OK 0.0000 0.0030 2.964 3.009 100.0 100.5 100.3 101.6025 0.58 OK OK 0.0030 0.0030 2.967 3.009 10.0 101.5 10.3 151.4025 0.05 0.05 0.05 OK OK 0.0020 0.0015 0.0015 2.967 3.069 15.0 15.4 15.6 15.3 15.497 15.0 0.05 OK OK 0.0010 0.0010 2.967 3.069 4.0 4.1 4.2 4.0 4.0597 2.44 -1.22 OK OK 0.0007 0.0007 2.967 3.069 2.0 2.0 2.1 2.0 2.0247 5.00 122 OK OK 0.0017 0.0007 10.0010 2.967 3.069 2.0 2.0 2.1 2.0 2.0247 5.00 122 OK OK 0.0017 0.0017 0.0017	Actual	Target	Actual	Target	Target	PPB	PPB	PPS	PPB	PPB	PPB	OK?	OK?	
0.0000 0.0000 0.0000 2.0000 100.0 100.0 100.0 100.0 100.0 100.0 0.00000 0.00000 0.00000 0.000000 </td <td>0.000</td> <td>0.000</td> <td>3.000</td> <td>3.008</td> <td>ZERO</td> <td>0.000</td> <td>0.0002</td> <td>0.1</td> <td>0.1080</td> <td>IN/A</td> <td>INIA</td> <td>OK</td> <td>OK</td>	0.000	0.000	3.000	3.008	ZERO	0.000	0.0002	0.1	0.1080	IN/A	INIA	OK	OK	
0.0030 0.0030 2.967 0.069 44.0 40.7 40.8 40.2 40.7213 0.25 0.065 Ock Ock 0.0030 0.0030 2.967 3.069 15.0 15.4 15.49/14 15.49/14 15.49/14 15.49/14 15.49/14 15.49/14 15.49/14 15.49/14 14.1 4.55 OCK <	0.0050	0.0069	2.994	3.069	70.0	71.0	70.8	70.5	71.4152	-0.50	0.59	OK	on on	
0.0020 0.0020 2.997 3.099 15.0 15.4 15.6 15.3 15.4074 1.300 0.013 OK OK OK 0.0015 0.0015 2.997 3.099 1.0 2.1 7.0 7.097 1.41 -0.15 OK OK <td>0.0030</td> <td>0.0030</td> <td>2.997</td> <td>3.069</td> <td>40.0</td> <td>40.7</td> <td>40.8</td> <td>40.2</td> <td>40,7213</td> <td>0.25</td> <td>0.05</td> <td>OK</td> <td>OK</td>	0.0030	0.0030	2.997	3.069	40.0	40.7	40.8	40.2	40,7213	0.25	0.05	OK	OK	
0.0015 0.0015 2.997 3.069 7.0 7.1 7.2 7.0 <	0.0020	0.0020	2.997	3.069	15.0	15.4	15.6	15.3	15.4976	1.30	0.63	OK	OK	
0.0010 0.0010 2.997 3.099 4.0 4.3 4.2 4.9 4.0027 2.44 1.22 OK OK OK 832 Readings 2.00 2.0 2.0 2.1 2.0 2.0217 5.00 1.22 OK OK OK 802 Readings 0 0.0017 0.0007 0.0007 0.001 1.22 OK	0.0015	0.0015	2.997	3.069	7.0	7.1	7.2	7.0	7.0897	1.41	-0.15	OK	OK	
Cover Cover <th< td=""><td>0.0010</td><td>0.0010</td><td>2.997</td><td>3.069</td><td>4.0</td><td>4.1</td><td>4.2</td><td>4.0</td><td>4.0507</td><td>2.44</td><td>-1.22</td><td>OK</td><td>OK</td></th<>	0.0010	0.0010	2.997	3.069	4.0	4.1	4.2	4.0	4.0507	2.44	-1.22	OK	OK	
B12 Reduing Ch-PM Minute Aver. Diversities 0 Control 0	0.0007	0.0007	2.000	3.009	2.0	2.0	- 21	2.0	2.0247	5.00	3340	Un	UNC .	
SO-VER 0 I 000-VER 0 I	8832 Readings		43i-de Minute Ar	wer.										
Sec-107 I Institute To My Additional Sec TVE AD	1002-0 4104 (D)		10.20 11.16.15 Rays 402	100000 pe2 0 088										
S00-17 (p. 1) 11111114-11 spin - CONVENTIONE S00-17 (p. 1) 1111114-11 spin - CONVENTIONE S00-17 (p. 1) 11111114-11 spin - CONVENTIONE S00-17 (p. 1) 111111111 S00-17 (p. 1) 11111111 S00-17 (p. 1) 111111111 S00-17 (p. 1) 111111111 S00-17 (p. 1) 111111111 S00-17 (p. 1) 11111111 S00-17 (p. 1) 111111111 S00-17 (p. 1) S00-111111 S00-17 (p. 1) S00-1111111 S00-17 (p. 1) S00-11111111 S00-17 (p. 1) S00-11111111111111111111111111111111111	802-717 (D)		11.00 11.10.15 Tags #CI	1000000 war 112 820										
001-107 (0) 1 113-113-15 Bap 400000 40 (1)19 900-107 (0) 1 113-15 Bap 400000 40 (1)19 900-107 (1)19	302+47.19 (D)		11:10:11:16-15 flags #CI	000000 with 45 388										
Discrete training	902+10.01 (D)		11.37 11-16-15 Rags 403	000000 mi2 13 5/10										
OS DAB RECRESSION RESULTE AND CRITERIA (9, Y) SUSTAND SUSTAND <td>900+A409 (D - 1</td> <td></td> <td>12-11-16-15 Regs 401</td> <td>000000 w42 4 825</td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td>	900+A409 (D - 1		12-11-16-15 Regs 401	000000 w42 4 825										
OS DAS RECRESSION RESULTS AND CRITERIA (X,Y) CONTRACT DECRE (MM NOSS SUCRE (MM NOSS NOSS NOSS SUCRE (MM NOSS NOSS NOSS NOSS NOSS SUCRE (MM NOSS NOSS <th co<="" td=""><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td></th>	<td></td>													
Sectore														
DAS REGRESSION RESULTS AND CRITERIA (X,Y) DECRESSION RESULTS AND CRITER														
Difference of the construction				03 045 8505	PERSON PE	BUT TO AND	CONTROLATION VI					_	1	
Distribution BLOPE (M) 4.0054 BITERECENT (B) 4.1497 RECENT	Contract of the second s			Sector Sector	a server ma									
EXCELLENT (BB4 + 49c + 10) // EXCELLENT (A02 + 80 + 300) // EXCELLENT (D-5000) // Sampactory (BB4 + 49c + 10) // Sampactory (Correl + 3000) Sampactory (D-1000) // Sampactory (BB4 + 49c + 10) // Sampactory (Correl + 3000) Sampactory (D-1000) // UNEXTRACTORY (Sampace SELE) UNEXTRACTO	EXCLUSIVE.	BLOPE (M	1 100	54	14.71	RCOPT IN	-0.1487	Contract and	1	Recent	remailer v de	00		
EXCELLING (INN + NH + 100) * EXCELLING (INN + + 04000) * SATISFACTORY(INN+NH+10) SATISFACTORY(INN+NH+10) SATISFACTORY(INN+NH+10) SATISFACTORY(INN+NH+10) UNIESTATISFACTORY(INN+NH+10) SATISFACTORY(INN+NH+10) UNIESTATISFACTORY(INN+NH+10) SATISFACTORY(INN+NH+10)		111			-						in the second second			
5.8.7.897 (2004) (300-500-130) 5.8.7.897 (2004) (3.8.13 + 4.8.196) 5.8.7.897 (2004) (3.8.13 + 4.8.196) 1.0.8.5.7.8.7.7.100(-0.8.1000) URESATING CONVERSION (0.8.1000) URESATING CONVERSION (0.8.1000)		EXCELLENT	10.00 + < 0< + 1.02)				CELLENT (-0.002+-80++0.002)	× .		EXC	BLEENT IN HE DEE	0		
UNEATERFACTORY(E) / UNEATE		BATHER AT TH	STREET, BRIDGE, MILLION, MILLI				the second second second second second second							
							PACTORY (CENTER OF BRANDING			SATISF	ACTIONY (* HE BER	n		

Figure 13: Performance Audit Worksheet

3.8.1.3 The audit dynamic calibrator's mass flow controllers must be certified against authoritative standards such as an NIST traceable bubble meter, a wet test meter, or a BIOS flow calibrator within the last 6 months. The dynamic calibrator flows must be certified semi-annually.

3.8.1.4 Plug in the dynamic calibrator and turn power on. The calibration unit must warm up at least 30 minutes prior to use. Connect an independent source of zero air to the zero air inlet of the dynamic calibration unit. Turn on the zero air pump. Set the zero air delivery pressure to 25 psig. Attach a two-stage regulator to the audit SO2 cylinder. Quickly open and close the cylinder valve on the SO2 audit cylinder and adjust the 1st stage regulator valve to 24 psig. Open the second stage valve and allow the regulator to empty. Close the second stage valve. Repeat this process 5 times to evacuate residual gases in the regulator. **The regulator evacuation should be performed in a well ventilated area.** After the evacuation procedure fill the regulator with gas leaving the second stage valve closed. Connect the SO2 regulator to the audit calibrator with the appropriate tubing (stainless steel) and fitting (stainless steel). Open the second stage regulator

Section 3 SOP for SO2 May 2016 Page 29 of 35 Revision 1

valve to the maximum. Adjust the second stage pressure to 24 psig. Check the fittings for leaks with Snoop[®]. Record the cylinder pressure.

3.8.1.5 Log in on the datalogger. Disable the SO₂ channel. See section 3.4.1.4 on how to Disable the channel.

3.8.1.6 Verify the output of the Audit Gas Dilution System (Calibrator) is connected to the SO2 cal line so gas is supplied to the sample line of the monitor to be calibrated. See section 3.2.2.10.

3.8.1.7 Start the dynamic calibrator zero air sequence to deliver zero air to the analyzer. Use a total flow appropriate for the analyzer's needs, which should be \sim 3.0 LPM. Verify zero air is making it into the 43i-tle. Readings should drop near zero within 30 seconds.

3.8.1.8 Allow the Model 43i-tle to sample zero air until a stable reading is obtained, at least 15 minutes, by checking the SO2 stability channel on the 8832. It needs to be less than 1 ppb.

3.8.1.9 After stability is good, collect instantaneous snapshot of the ppb reading from the 8832 and a minute average (SREC) from the analyzer. Use iPort to retrieve the SREC from analyzer by going to the simulator and click 'TERM' for the terminal screen. The "TERM" button toggles from "GRAPH" to "TERM" when it is pressed. Type in 'SREC' beside "43i->" and hit enter. Copy the SREC string (Fig. 8) and paste it into the Excel logbook.

3.8.1.10 Using the dynamic calibrator run the next appropriate point in a given audit level per section 3.8.1.1.

3.8.1.11 Allow the instrument to come to a stable reading. It may require 10 to 30 minutes for the point to stabilize.

3.8.1.12 After stability is good (< 1 ppb), collect instantaneous snapshot of the ppb reading from the 8832 and a minute average (SREC) from the analyzer. Use iPort to retrieve the SREC from analyzer by typing 'SREC' beside "43i->" and hit enter. Copy the result string and paste it into the Excel logbook.

3.8.1.13 Repeat 3.8.1.10 – 3.8.1.12 until audit is complete.

3.8.1.14. The percent difference for each point must be $< \pm 10.0\%$.

3.8.1.15 If the above criteria cannot be met inform the Program Manager. If the criteria are met proceed with next step.

3.8.1.16 Open and label the Digitrend SO2 graph stored on the site computer with a memo stating what was done and look at the trace to verify points were flat and display a good "stair-step" appearance.

3.8.1.17 Place Calibrator is in 'Standby' mode and disconnect the analyzer sample line from the audit calibrator. **Reconnect the cal line back to the solenoid that controls the auto-cal air**

Section 3 SOP for SO2 May 2016 Page 30 of 35 Revision 1

flow. This will allow the sample line to sample ambient air once again. Confirm analyzer is readings ambient levels once again. If slow to return, run a final zero to test for drift and flush line.

3.8.1.18 Once analyzer is reading ambient levels again, enable the data logger channel by returning to the 'CONFIGURATION MENU'.

3.8.1.18.1 Click on 'Configure Data Channels'

3.8.1.18.2 Click on 'Enable/Mark Channel Online'

3.8.1.18.3 Select channel to be enabled. Press Enter to enable the channel. The SO2 channel is now online.

3.8.1.19 Close the SO₂ audit standard cylinder valve and disconnect from the calibration unit.

3.8.1.20 Enter notes of what was done in the EDAS site logbook.

3.8.1.21 As soon as possible after the QA procedure is performed the supervisor should review the results. Percent differences outside the \pm 10% range must be investigated further to see if corrective maintenance or action is necessary. The audit results should also be compared with previous audit results for the analyzer. Other unusual trends (positive or negative biases, one audit range consistently more in error than the others, etc.) should also be investigated to determine if corrective action is necessary.

3.8.2 Bi-weekly Zero/Span/Precision (ZSP) Checks

3.8.2.1 Zero-Span-Precision (ZSP) 14-day checks include a zero plus two points of a known SO2 concentration. ZSP checks are intended to verify the analyzer multipoint calibration and may be used to validate and invalidate data. ZSP checks are to be performed at least every 14 days (More frequently if necessary).

3.8.2.2 A ZSP check is performed by challenging the analyzer with two test points after a zero test is done. The test points consist of a concentration of 30-50 ppb SO₂ and an SO₂ concentration of approximately 80% of the calibration scale (100 ppb) of the analyzer.

3.8.2.3 Log in on the 8832 datalogger.

3.8.2.3.1 Type in the Password and press ENTER.

3.8.2.3.2 Down/disable the SO2 channel.

3.8.2.3.3 The SO₂ channel is now offline. Check both the data logger and analyzer times and make sure they are correct. The datalogger time should be 1 minute of EST. Record the date, pollutant, monitor serial number, and the system operator signature in the instrument's Excelbased logbook (Fig. 14).

Section 3 SOP for SO2 May 2016 Page 31 of 35 Revision 1

14					SO2	ZSP					
DATE:	11/19/2015		TIME:	8:30	EST	OPI	ERATOR:	JRB	SITE	на	
-	an ann an stàiteach		1000-0001								
DATA LOGGER	CHECKS:		MODEL	8832		SERIAL #	A4303K		Last 8	832 Cal Done:	11/4/15
		8832 D	ate Correct?	y					Next	8832 Cal. Due:	5/4/16
т	me Date of h	900 22.88 ta	within 15 57	8:05					CPU	Time Correct?	1
	Ine Date of a	151 0002 post	by the GP of	0.05					. Gru	Time courecar	
43i-tle DIAGNOS	TICS	819230552	1	6/24/15	6	700EU Dia	ignostics	616-s		8/24/2015	
SO2 coeff	0.954	serial #	1	ast Calibrati	on		-	serial#.		Last MFC Cert	
SO2 bkg	1.6							Laure and		a marine i la	
Range	100			9/20/15	2	Calibration	Cylinder	CC367593	9.8	1900	8/15/18
aver time	60		L	ast Verificati	on			NUMBER	PPM	PRESSURE	EXP DAT
units	ppb										
Pressure	714.7			12/19/15		har and	anner an	1.12	1000	and the second	
Comp	ON		1	/erification di	10	ZERO AIR/AJ	PI T701H:	60	29	8/21/2014	
Internal Temp	31.1							SERIAL #	PSI	Last Maint.	
Chamber Temp	45		2.4	11/5/2015		Churchert	and the state	to the second second			Vee
Flow	0.498		Prob	e box filter ch	anged	Checked	ninute da	ta from last	check for	any bad data:	Yes
Lamp Intensity	89%					_	_		_		
					DAS	TEI 431 TLE					
				Slope	100.3802	1.0122					
		at the second		Intercept	-0.0805	-0.1171					
SULFUR DIOXIC	E OPERAT	IONAL CHE	CKS:			0.0.0	0.0.0	121	41 010		
	0001044	0001004	-	10100	EVO	OBS	OBS	ADJ	% DIP	FERENCE	DAS
DOMING	SOZLPM	SOZUPM	ARLPM	ARLPM	EAP	DAS	431-00	430-00	048	431.840	OKA
POINTS	Actual	Target	Actual	Target	[PPB]	0.440	PPB	0.000	DAS	4-30-00	UKY
SDAN	0.006	0.0050	2 004	3,060	90	90.7	55.5	87.49	0.80	.2 79	VES
PREC	0.003	0.0039	2 997	3,069	40	40.5	39.4	39.75	1.20	-0.63	VES
THES	0.000	0.002.0	A. HANK	0.000		10.0		00.70	118.9	1.11	120
SULFUR DIOXID	E CONTRO	L LIMITS:		DIAG OUT	PUT:						
ZERO DIFFERE	NCE <**/!	005 PPB?	YES		ZERO	SO2=-0.410	4 (D)	0	_		
SPAN DIFFERE	NCE <= +/-	10 %?	YES			13:35 11-05	-15 flags	4C000000 s	o2 0.027		
PRECISION DIF	FERENCE +	=+/- 10%?	YES								
			100 000	6	SPAN	SO2= 90.72	(D)				
	Site	temperature	25			13:47 11-05	-15 flags	4C000000 s	02 86.550		
Ent	ered Logbook	Comments:	У			-	and a				
Enter	ed Memo on	Digital Chart	у		PREC	SO2= 40.48	(D)	harris and			
Downlo	aded LRECs	from 43i-tle.	Y	-		14:01 11-05	-16 flags	4C000000 s	02 39.386	8 6	
		UPS Check	У	Comments:							
P.4.1	Fire Extingu	isher Check:	y								
Filter Cha	nge and Leak	Check OK?	y								
PTODE S/C2 abo	coolineusarr	after chore?	y y								
3U2 (N	us etti ettableetti	and check?	y								

Figure 14: Instrument Logbook, Zero/Span/Precision (ZSP) worksheet

3.8.2.4 Verify that the analyzer is working within specifications (see 3.2.4.5-3.2.4.11). Connect to the analyzer using iPort software. Open iPort and click the connect button. The simulator of the 43i-tle should show up on the screen. (Fig. 6)

3.8.2.5 Record the diagnostic observations in the logbook. If these specifications are not met consult the instrument instruction manual for corrective action.

3.8.2.6 Verify the output of the Audit Gas Dilution System (Calibrator) is connected to the SO2 cal line so gas is supplied to the sample line of the monitor to be calibrated. See section 3.2.2.10.

3.8.2.7 Using the Gas Dilution System (Calibrator), run the 'SO2 ZERO' sequence. This sequence is programmed into the 700EU Calibrator and will supply zero air to the 43i-tle.

3.8.2.8 Verify zero air is making it into the 43i-tle. Readings should drop near zero within 30 seconds.

3.8.2.9 Allow the Model 43i-tle to sample zero air until a stable reading is obtained, at least 15 minutes, by checking the SO2 stability channel on the 8832. It needs to be less than 1 ppb.

Section 3 SOP for SO2 May 2016 Page 32 of 35 Revision 1

3.8.2.10 After stability is good, collect instantaneous snapshot of the ppb reading from the 8832 and a minute average (SREC) from the analyzer. Use iPort to retrieve the SREC from analyzer by going to the simulator and click 'TERM' for the terminal screen. The "TERM" button toggles from "GRAPH" to "TERM" when it is pressed. Type in 'SREC' beside "43i->" and hit enter. Copy the SREC string (Fig. 5) and paste it into the Excel logbook.

3.8.2.11 Using the Gas Dilution System (Calibrator), run the 'SO2 90' sequence. This sequence is programmed into the 700EU Calibrator and will supply a concentration of 90 ppb of SO2 to the 43i-tle.

3.8.2.12 Allow the instrument to come to a stable reading. It may require 10 to 30 minutes for the point to stabilize.

3..2.14 After stability is good (< 1 ppb), collect instantaneous snapshot of the ppb reading from the 8832 and a minute average (SREC) from the analyzer. Use iPort to retrieve the SREC from analyzer by typing 'SREC' beside "43i->" and hit enter. Copy the result string and paste it into the Excel logbook.

3.8.2.15 Using the Gas Dilution System (Calibrator), run the 'SO2 40' sequence. This sequence is programmed into the 700EU Calibrator and will supply a concentration of 40 ppb of SO2 to the 43i-tle. Allow the instrument to come to a stable reading. It may require 10 to 30 minutes for the point to stabilize. After stability is good (< 1 ppb), collect instantaneous snapshot of the ppb reading from the 8832 and a minute average (SREC) from the analyzer. Use iPort to retrieve the SREC from analyzer by typing 'SREC' beside "43i->" and hit enter. Copy the result string and paste it into the Excel logbook.

3.8.2.16. The percent difference for each point must be < \pm 10.0%. The zero results should be < \pm 0.5 ppb but must be < \pm 1.0 ppb.

3.8.2.17 If the above criteria cannot be met inform the Program Manager. If the criteria are met proceed with next step.

3.8.2.18 Open and label the Digitrend SO2 graph stored on the site computer with a memo stating what was done and look at the trace to verify points were flat and display a good "stair-step" appearance.

3.8.2.18.1 Record the visit in the Agilaire EDAS logbook (Fig. 15).

Section 3 SOP for SO2 May 2016 Page 33 of 35 Revision 1



Figure 15: Agilaire EDAS logbook entry

3.8.2.19 Place Calibrator is in 'Standby' mode. This will allow the sample line to sample ambient air once again. Confirm analyzer is readings ambient levels once again. If slow to return run a final zero to test for drift and flush line.

3.8.2.20 Once analyzer is reading ambient levels again, enable the data logger channel by returning to the 'CONFIGURATION MENU'.

3.8.2.20.1 Click on 'Configure Data Channels'

3.8.2.20.2 Click on 'Enable/Mark Channel Online'

3.8.2.20.3 Select channel to be enabled. Press Enter to enable the channel. The SO2 channel is now online.

3.8.3 Thermo 43i-tle SO2 Analyzer Nightly Auto-Calibrations

Each night an auto-calibration is triggered by the datalogger and controlled by the calibrator to further test and confirm the equipment's operational status. This program starts at a selected time when ambient readings for a specific pollutant are at their lowest point in a typical diurnal pattern. The datalogger triggers the auto-cal to start but then hands over control to the calibrator. The timing of the check for both the datalogger and calibrator are in sync so the datalogger can capture expected results from the calibrator and the analyzer at the right moment. These records are flagged by the datalogger as calibrations and the results are reported to AQS as QC checks. All auto-cals run at least a zero point and a precision point (a point near the current standard) but could include additional points if needed. Auto cal results have to meet the 10% difference. If it does not meet this then corrective action is required. Some troubleshooting may be needed if results are greater than 7% so data loss can be avoided. Most auto-cals are also programmed so reportable hours are not lost in the process. Operators and staff review the results of the auto-cals every workday since all values show up on a daily report (see Data Handling and Reporting SOP section 10).

Section 3 SOP for SO2 May 2016 Page 34 of 35 Revision 1

3.9 Data Handling - Documentation, Analysis, Editing, and Reporting

See the Data Handling and Processing SOP, which is Section 10.

Section 3 SOP for SO2 May 2016 Page 35 of 35 Revision 1

REFERENCES

Quality Assurance Handbook for Air Pollution Measurement Systems, Volume II- Ambient Air Specific Methods, EPA-454/B-13-003 (2013), U.S. Environmental Protection Agency, Environmental Monitoring Systems Laboratory, Research Triangle Park, N.C. 27711.

Title 50 Code of Federal Regulations Part 58- Ambient Air Quality Surveillance. 1993.

Transfer Standards for Calibration of Air Monitoring Analyzers for SO2. Technical Assistance Document. EPA-454/B-10-001. United States Environmental Protection Agency, November, 2010.